

FUNDERMAX GMBH TEST REPORT

SCOPE OF WORK

REPORT OF TESTING 6 MM. THICK MAX COMPACT INTERIOR F QUALITY PANELS FOR COMPLIANCE WITH THE APPLICABLE REQUIREMENTS OF THE FOLLOWING CEITERIA: CAN/ULC S102-18, STANDARD METHOD OF TEST FOR SURFACE BURNING CHARACTERISTICS OF BUILDING MATERIALS AND ASSEMBLIES.

REPORT NUMBER

103822212OQ-001A R0 TEST DATE(S)

04/30/19 - 04/30/19


ISSUE DATE [REVISED DATE] 05/03/19 05/06/19

PAGES

14

DOCUMENT CONTROL NUMBER

GFT-OP-10c (AUGUST 27, 2018) © 2017 INTERTEK

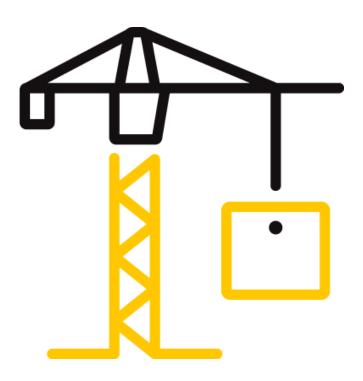



Telephone: 604-520-3321 www.intertek.com/building

TEST REPORT FOR FUNDERMAX GMBH

Report No.: 1038222120Q-001A R0

Date: 05/03/19

REPORT ISSUED TO

FUNDERMAX GMBH

Klagenfurter Strasse 87-89 A-9300 Klagenfurt, Austria

SECTION 1

SCOPE

Intertek Building & Construction (B&C) was contracted by Fundermax GmbH. to perform testing in accordance with CAN/ULC S102-18, Standard Method of Test for Surface Burning Characteristics of Building Materials and Assemblies., on their 6 mm. thick Max Compact Interior F Quality Panels. Results obtained are tested values and were secured by using the designated test method(s). Testing was conducted at Intertek Testing Services NA Ltd. (Intertek) test facility in Coquitlam, BC Canada.

This report does not constitute certification of this product nor an opinion or endorsement by this laboratory.

SECTION 2

SUMMARY OF TEST RESULTS

The samples of 6 mm. thick Max Compact Interior F Quality panels submitted by Fundermax GmbH. were tested in accordance with CAN/ULC S102-18, Standard Method of Test for Surface Burning Characteristics of Building Materials and Assemblies.

The product test results are presented in Section 10 of this report.

For INTERTEK B&C:

COMPLETED BY: Sean Fewer REVIEWED BY: Greg Philp

TITLE: Technician – B&C

TITLE: Reviewer- B&C

SIGNATURE: DATE: 05/03/19

Greg Philp

Reviewer- B&C

O5/03/19

This report is for the exclusive use of Intertek's Client and is provided pursuant to the agreement between Intertek and its Client. Intertek's responsibility and liability are limited to the terms and conditions of the agreement. Intertek assumes no liability to any party, other than to the Client in accordance with the agreement, for any loss, expense or damage occasioned by the use of this report. Only the Client is authorized to permit copying or distribution of this report and then only in its entirety. Any use of the Intertek name or one of its marks for the sale or advertisement of the tested material, product or service must first be approved in writing by Intertek. The observations and test results in this report are relevant only to the sample(s) tested. This report by itself does not imply that the material, product, or service is or has ever been under an Intertek certification program.



Telephone: 604-520-3321 www.intertek.com/building

TEST REPORT FOR FUNDERMAX GMBH

Report No.: 1038222120Q-001A R0

Date: 05/03/19

SECTION 3

TEST METHOD(S)

The specimens were evaluated in accordance with the following:

CAN/ULC S102-18, Standard Method of Test for Surface Burning Characteristics of Building Materials and Assemblies.

SECTION 4

MATERIAL SOURCE/INSTALLATION

Samples were submitted to Intertek directly from the client and were not independently selected for testing and Intertek accepts no responsibility for any inaccuracies provided. The sample material was received at the Evaluation Center on April 15, 2019.

SECTION 5

EQUIPMENT

ASSET #	DESCRIPTION	MODEL	CAL DUE DATE
WH2189	Photocell	Huygen 856	10/09/18
WH 2190	Smoke Opacity Meter	Huygen	10/09/18
WH 2494	Data Logger	Yokogawa DA100	07/18/18

SECTION 6

LIST OF OFFICIAL OBSERVERS

NAME	COMPANY
Sean Fewer	Intertek B&C
Greg Philp	Intertek B&C



Telephone: 604-520-3321 www.intertek.com/building

TEST REPORT FOR FUNDERMAX GMBH

Report No.: 1038222120Q-001A R0

Date: 05/03/19

SECTION 7

TEST CALCULATIONS

The results of the tests are expressed by indexes, which compare the characteristics of the sample under tests relative to that of select grade red oak flooring and inorganic-cement board.

(A) Flame Spread Rating:

This index relates to the rate of progression of a flame along a sample in the 25 foot tunnel. A natural gas flame is applied to the front of the sample at the start of the test and drawn along the sample by a draft kept constant for the duration of the test. An observer notes the progression of the flame front relative to time.

The test apparatus is calibrated such that the flame front for red oak flooring passes out the end of the tunnel in five minutes, thirty seconds (plus or minus 15 seconds).

(B) Smoke Developed:

A photocell is used to measure the amount of light, which is obscured by the smoke passing down the tunnel duct. When the smoke from a burning sample obscures the light beam, the output from the photocell decreases. This decrease with time is recorded and compared to the results obtained for red oak, which is defined to be 100.

SECTION 8

TEST SPECIMEN DESCRIPTION

Upon receipt of the samples at the Intertek Coquitlam laboratory they were placed in a conditioning room where they remained in an atmosphere of 23 \pm 3°C (73.4 \pm 5°F) and 50 \pm 5% relative humidity.

The sample material was identified by the client as 6 mm. thick Max Compact Interior F Quality Panels.

For each trial run, three 8 ft. long by 24 in. wide sample panels were butted together and placed on the upper ledge of the flame spread tunnel to form the required 24 ft. sample length. A layer of 6 mm reinforced cement board was placed over top of the samples, the tunnel lid was lowered into place, and the samples were then tested in accordance with CAN/ULC S102-18.



Telephone: 604-520-3321 www.intertek.com/building

TEST REPORT FOR FUNDERMAX GMBH

Report No.: 1038222120Q-001A R0

Date: 05/03/19

SECTION 9

TEST RESULTS

(A) Flame Spread

The resultant flame spread ratings are as follows: (Rating rounded to nearest 5)

6 mm. thick Max Compact Interior F Quality Panels	Flame Spread	Flame Spread Rating
Run 1	0	
Run 2	0	0
Run 3	0	

(B) Smoke Developed

The areas beneath the smoke developed curve and the related classifications are as follows: (Classification rounded to nearest 5)

6 mm. thick Max Compact Interior F Quality Panels	Smoke Developed	Smoked Developed Classification
Run 1	42	
Run 2	62	55
Run 3	56	

(C) Observations

During the test runs, surface ignition occurred between 298 and 310 seconds; the flame then began to progress along the sample length until it reached the maximum flame spread. This was the case for all three test runs.



Telephone: 604-520-3321 www.intertek.com/building

TEST REPORT FOR FUNDERMAX GMBH

Report No.: 1038222120Q-001A R0

Date: 05/03/19

SECTION 10

CONCLUSION

The samples of 6 mm. thick Max Compact Interior F Quality Panels submitted by Fundermax GmbH exhibited the following flame spread characteristics when tested in accordance with CAN/ULC S102-18, Standard Method of Test for Surface Burning Characteristics of Building Materials and Assemblies.

A series of three test runs of material was conducted to conform to the requirements of the National Building Code of Canada.

Sample Material	mple Material Flame Spread Smoke D Rating Classis	
6 mm. thick Max Compact Interior F Quality Panels	0	55

The conclusions of this test report may not be used as part of the requirements for Intertek product certification. Authority to Mark must be issued for a product to become certified.

Version: AUGUST 27, 2018 Page 6 of 15 GFT-OP-10c



Telephone: 604-520-3321 www.intertek.com/building

TEST REPORT FOR FUNDERMAX GMBH

Report No.: 1038222120Q-001A R0

Date: 05/03/19

SECTION 11

TEST DATA (6 PAGES)



Telephone: 604-520-3321 www.intertek.com/building

TEST REPORT FOR FUNDERMAX GMBH

Report No.: 1038222120Q-001A R0

Date: 05/03/19

Standard: ULC S	S102 Page 1 of 2
Client: FunderMax GMBH	
Date: 04 30 2019	
Project Number: 103822212	
Test Number: 1	
Operator: Sean Fewer	
Specimen ID: 1/4 in. max compact interi	ior F quality panels
TEST RESULTS	
FLAMESPREAD INDEX:	0
SMOKE DEVELOPED INDEX:	40
SPECIMEN DATA	
Time to Ignition (sec):	
Time to Max FS (sec): Maximum FS (mm):	
Time to 527 C (sec):	
Time to End of Tunnel (sec):	
Max Temperature (C):	
Time to Max Temperature (sec):	597
Total Fuel Burned (cubic feet):	45.70
FS*Time Area (M*min)	: 0.0
Smoke Area (%A*min):	: 66.7
Unrounded FSI:	
Unrounded SDI:	: 42.3
CALIBRATION DATA	
Time to Ignition of Last Red Oak (Sec):	48.0
Red Oak Smoke Area (%A*min):	
Tested By: SF	Reviewed By:
8	




Telephone: 604-520-3321 www.intertek.com/building

TEST REPORT FOR FUNDERMAX GMBH

Report No.: 1038222120Q-001A R0

Date: 05/03/19

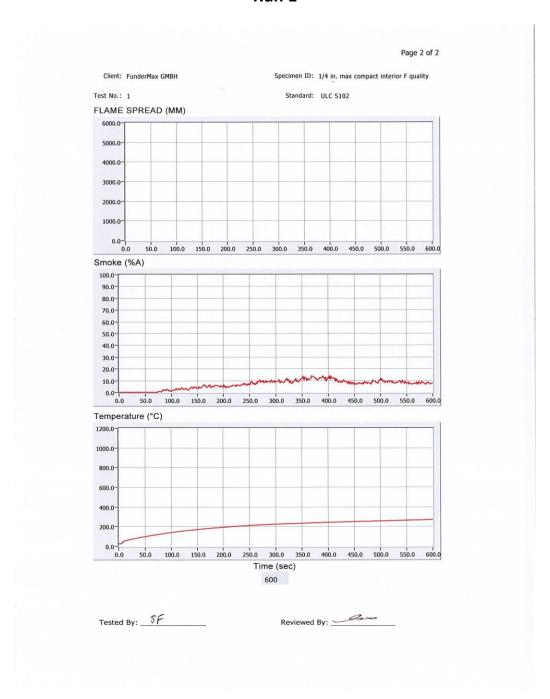



Telephone: 604-520-3321 www.intertek.com/building

TEST REPORT FOR FUNDERMAX GMBH

Report No.: 1038222120Q-001A R0

Date: 05/03/19

Standard:	ULC S	3102		Page 1 of 2
Client: F	underMax GMBH			
Date: (04 30 2019			
Project Number: 1	103822212			
Test Number: 2				
Operator: 5				
Specimen ID: 1	/4 in. max compact interio	or F quality pane	1	
TEST RESULTS				
F	FLAMESPREAD INDEX:	0		
SMOK	E DEVELOPED INDEX:	60		
SPECIMEN DATA				
	Time to Ignition (sec):	305		
	Time to Max FS (sec):	0		
	Maximum FS (mm):	0.0		
	Time to 527 C (sec):	Never Reached		
Time	e to End of Tunnel (sec):	Never Reached		
	Max Temperature (C):	264		
	Max Temperature (sec):			
Total F	uel Burned (cubic feet):	45.70		
	FS*Time Area (M*min):	0.0		
	Smoke Area (%A*min):	98.0		
	Unrounded FSI:			
	Unrounded SDI:	62.2		
CALIBRATION DATA .				
Time to Ignition of	of Last Red Oak (Sec):	48.0		
Red Oak S	Smoke Area (%A*min):	157.5		
Tested By: SF			Reviewed By:	-
rested by: <u>J</u>			reviewed by:	




Telephone: 604-520-3321 www.intertek.com/building

TEST REPORT FOR FUNDERMAX GMBH

Report No.: 1038222120Q-001A R0

Date: 05/03/19

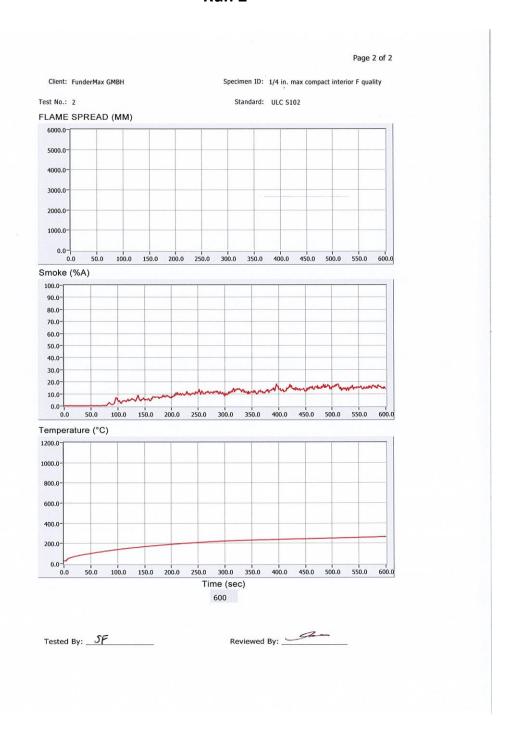



Telephone: 604-520-3321 www.intertek.com/building

TEST REPORT FOR FUNDERMAX GMBH

Report No.: 1038222120Q-001A R0

Date: 05/03/19

Standard: ULC	S102	Page 1 of	f 2
Client: Fundermax GMBH			
Date: 04 30 2019			
Project Number: 103822212			
Test Number: 3			
Operator: Sean Fewer			
Specimen ID: 1/4 in. max compact int	terior F quality pane		
TEST RESULTS			
FLAMESPREAD INDE	X: 0		
SMOKE DEVELOPED INDE	X: 55		
SPECIMEN DATA			
Time to Ignition (se	a): 208		
Time to ignition (se			
Maximum FS (mr			
Time to 527 C (se	di mana anno anno anno		
Time to End of Tunnel (se			
Max Temperature (Time to Max Temperature (se			
Total Fuel Burned (cubic fee			
FS*Time Area (M*m	in): 0.0		
Smoke Area (%A*m	in): 88.9		
Unrounded F Unrounded S			
Official ded 3	DI. 30.4		
CALIBRATION DATA			
Time to Ignition of Last Red Oak (Sec	c): 48.0		
Red Oak Smoke Area (%A*mi	n): 157.5		
Tested By:		Reviewed By:	-




Telephone: 604-520-3321 www.intertek.com/building

TEST REPORT FOR FUNDERMAX GMBH

Report No.: 1038222120Q-001A R0

Date: 05/03/19

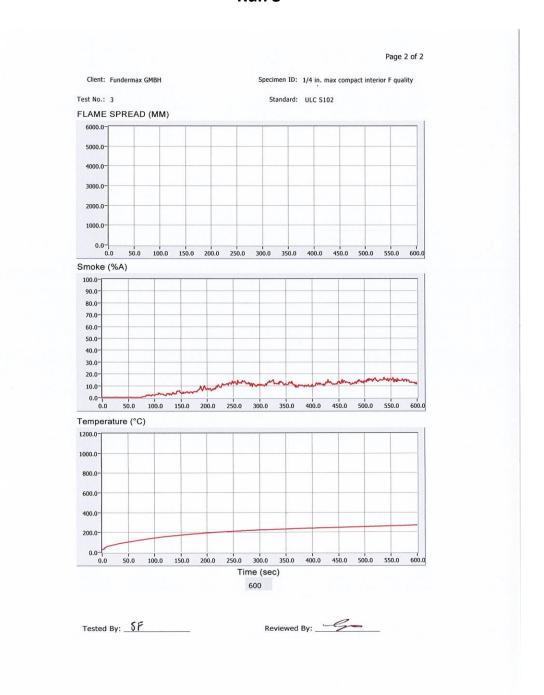



Telephone: 604-520-3321 www.intertek.com/building

TEST REPORT FOR FUNDERMAX GMBH

Report No.: 1038222120Q-001A R0

Date: 05/03/19

SECTION 12

PHOTOGRAPHS



Photo No. 1 Pre Test



Photo No. 2 Post Test



Telephone: 604-520-3321 www.intertek.com/building

TEST REPORT FOR FUNDERMAX GMBH

Report No.: 103822212OQ-001A R0

Date: 05/03/19

SECTION 13

REVISION LOG

REVISION #	DATE	PAGES	REVISION
0	05/03/19	N/A	Original Report Issue
		Cover	
1	05/06/19	2,4,5,6	Corrected Thickness From 1/4 in. to 6 mm.